

Manhole Inspection Summary

Manhole # S51K__017MH

Printed On: 2/27/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **51K** Node: **017** Status: **Found**

Insp Date: **3/31/08 10:16 AM**

Incomplete Comments

Crew: **4**
Inspector: **jjoiner**
Firm: **ATS**

Location Address: **600 fleet st**

Cross Street: **s.linwood**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Wet**

☐ Prev. Rehab Weather: **Light Rain** Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **24** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **1** (in.) Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

Chimney / Frame Adjustment ☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **6** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☒ **Cracks** ☒ **Mortar** ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: **0** (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☒ **Cracks** ☒ **Mortar** ☐ Roots ☒ **Wall**

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **5** Missing: **0** ☒ **Corroded**

Surcharge ☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S51K__017MH


Printed On: 2/27/2009

Page 2 of 4

Location View



Top View

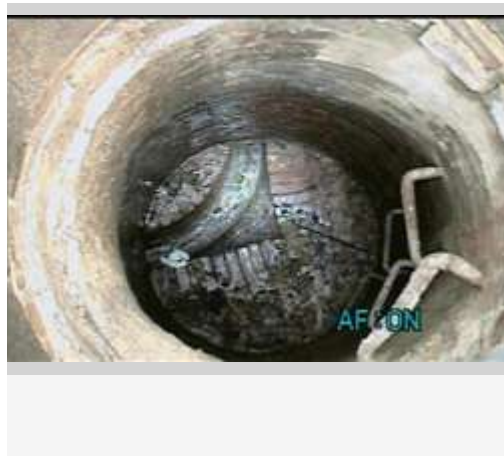

misc



bench debris

Defect 1



chimney loose bricks, frame adjustment

Defect 7



infiltration from frame adjust ment & street level.

Defect 6



cracks in barrel & infiltration

Manhole Inspection Summary

Manhole # S51K__017MH

Printed On: 2/27/2009

Page 3 of 4

Defect 5



cracked barrel

Defect 4



corbel infiltration

Defect 3



frame leaks, offset

Defect 2



steps

Manhole Inspection Summary

Manhole # S51K__017MH

Printed On: 2/27/2009

Page 4 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.75** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 9 O'Clock

9 O'Clock Inflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.66** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection